



THE GRENFELL TOWER INQUIRY

EXHIBIT TNG/4

This is the Exhibit marked “TNG/4”
referred to in the witness statement
of Tobias Neville Guise

Grenfell Tower 9497						GREEN HIGHLIGHT - VERY GOOD STANDARD	YELLOW HIGHLIGHT - NOT YET ACTIONED						CALL OUT RISK			POTENTIAL COST OF CALL			DATE RECTIFIED	COMMENTS
No of Inspections	Item Number	DATE OF INSPECTION	BLOCK / FLOOR / PLOT	LOCATION	ISSUE DESCRIPTION / STANDARD	PICTURE	JSW / SUB CONTRACTOR	STATUS	SNAGGED Y / N	COMMISSIONED	HANDED OVER	GOOD PRACTICE	LOW	MEDIUM	HIGH	LOW	MEDIUM	HIGH		
5	1	20/05/2015	Outside flat 183	Distribution pipework	Carbon pipework has pitting marks, I have marked the pipework to identify where it is		JSW	1st fix	N	N	N				1			1		
5	2	20/05/2015	Outside flat 156/155 new 18th floor	Distribution pipework	Carbon Pipework- the picture shows the pipework having a reaction on the outside of the pipe, this is a small part of a large length 28mm. This section of pipework has been cut out.		JSW	1st fix	N	N	N				1			1		Cut out 21/05/2015
5	3	20/05/2015	Outside flat 105	Distribution pipework	Carbon pipework has pitting marks, I have marked the pipework to identify where it is		JSW	1st fix	N	N	N				1			1		
5	4	20/05/2015	Outside flat 93	Distribution pipework	Carbon pipework has pitting marks, I have marked the pipework to identify where it is		JSW	1st fix	N	N	N				1			1		
5	5	20/05/2015	Outside flat 93	Distribution pipework	Carbon fittings have been marked in place, possible marked after it has been installed		JSW	1st fix	N	N	N				1			1		
5		20/05/2015	Summary									0	0	0	5	0	0	5		
		Carbon pipework item 2 - all the pipework throughout Grenfell tower has had no water in the pipe and has not been lagged. I think this maybe a issue with manufacturing																		