







# THE GRENFELL TOWER INQUIRY

---

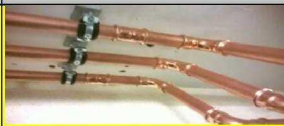


## EXHIBIT TNG/1

---

This is the Exhibit marked “TNG/1”  
referred to in the witness statement  
of Tobias Neville Guise

GREEN HIGHLIGHT - VERY GOOD STANDARD						YELLOW HIGHLIGHT - NOT YET ACTIONED															
No of inspections	Item Number	CONTRACT	DATE OF INSPECTION	BLOCK / FLOOR / PLOT	LOCATION	ISSUE DESCRIPTION / STANDARD	PICTURE	JSW / SUB-CONTRACTOR	STATUS	SMASSED Y / N	COMMISSIONED	HAILED OVER	NO ISSUE FOUND OR GOOD STANDARD	CALL OUT RISK LOW	CALL OUT RISK MEDIUM	CALL OUT RISK HIGH	LOW COST	MEDIUM COST	HIGH COST	0001/000	
1	1	Grenfell Tower	18/12/2014	Tower 20th floor outside flat 202	Corridor distribution	Geberit Mapress Copper no visible lines on pipework		JSW	1st fix	N	N	N			1					1	
1	2	Grenfell Tower	18/12/2014	Tower	Risers	No sleeving on pipework through the floors		JSW	1st fix	N	N	N			1					1	
1	3	Grenfell Tower	18/12/2014	Tower 17th floor	Corridor distribution	Geberit Mapress Carbon pipework fitting off the depth mark		JSW	1st fix	N	N	N			1					1	
1	4	Grenfell Tower	18/12/2014	Tower 17th floor outside flat 176	Corridor distribution	Geberit Mapress carbon pipework has not been fully inserted into the fitting (please cut out)		JSW	1st fix	N	N	N				1				1	
1	5	Grenfell Tower	18/12/2014	Tower 16th floor outside flat 161	Corridor distribution	Geberit Mapress carbon pipework no depth marks on pipework		JSW	1st fix	N	N	N			1					1	
1	6	Grenfell Tower	18/12/2014	Tower 16th floor outside flat 166	Corridor distribution	Geberit Mapress carbon pipework has been crimped on a angle (please cut out)		JSW	1st fix	N	N	N				1				1	

JSW00002043\_0002

1	7	Grenfell Tower	18/12/2014	Tower 16th floor riser	Corridor distribution	Geberit Mapress carbon no depth markings on the pipework		JSW	1st fix	N	N	N			1					1	
1	8	Grenfell Tower	18/12/2014	Tower 15th floor outside flat 152	Corridor distribution	Geberit Mapress carbon no depth markings on the pipework		JSW	1st fix	N	N	N			1					1	
1	9	Grenfell Tower	18/12/2014	Tower 15th floor outside flat 156	Corridor distribution	Geberit Mapress carbon no depth markings on the pipework		JSW	1st fix	N	N	N			1					1	
1	10	Grenfell Tower	18/12/2014	Tower 15th floor outside flat 154	Corridor distribution	Geberit Mapress carbon no depth markings on the pipework		JSW	1st fix	N	N	N			1					1	
1	11	Grenfell Tower	18/12/2014	Tower 15th floor outside flat 155	Corridor distribution	Geberit Mapress carbon pipework has not been fully inserted into the fitting (please cut out)		JSW	1st fix	N	N	N				1				1	
1	12	Grenfell Tower	18/12/2014	Tower 14th floor outside flat 144	Corridor distribution	Geberit Mapress carbon pipework has been crimped on a angle (please cut out)		JSW	1st fix	N	N	N				1				1	
1	13	Grenfell Tower	18/12/2014	Tower 13th floor outside flat 133	Corridor distribution	Geberit Mapress carbon no depth markings on the pipework		JSW	1st fix	N	N	N			1					1	
1	14	Grenfell Tower	18/12/2014	Tower 13th floor outside flat 134	Corridor distribution	Geberit Mapress carbon no depth markings on the pipework		JSW	1st fix	N	N	N			1					1	
1	15	Grenfell Tower	18/12/2014	Tower 12th floor outside flat 121	Corridor distribution	Geberit Mapress carbon pipework has not been fully inserted into the fitting (please cut out)		JSW	1st fix	N	N	N				1				1	
1	16	Grenfell Tower	18/12/2014	Tower 12th floor outside flat 116	Corridor distribution	Geberit Mapress carbon no depth markings on the pipework		JSW	1st fix	N	N	N			1					1	
1	17	Grenfell Tower	18/12/2014	Tower 11th floor outside flat 113	Corridor distribution	Geberit Mapress carbon pipework does not line up with drilled holes into the flat (possible damage please check)		JSW	1st fix	N	N	N				1				1	
1	18	Grenfell Tower	18/12/2014	Tower 8th floor	Corridor distribution	Geberit Mapress copper pipework on BCW no depth marks on male iron s		JSW	1st fix	N	N	N			1					1	
1	19	Grenfell Tower	18/12/2014	Tower 8th floor outside flat 72	Corridor distribution	Geberit Mapress copper pipework has not been fully inserted into the fitting (please cut out)		JSW	1st fix	N	N	N				1				1	
1		Grenfell Tower summary	18/12/2014												0	0	12	7	0	0	19
		All Geberit Copper and Carbon pipework needs to be fully checked as some parts of the install are very poor																			
		Please can I have copies of all site operatives that undertook the Mapress Training on Grenfell tower																			

JSW00002043\_0003