

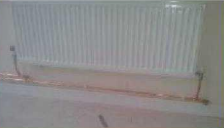

# THE GRENFELL TOWER INQUIRY

---

## EXHIBIT TNG/5

---

This is the Exhibit marked “TNG/5”  
referred to in the witness statement  
of Tobias Neville Guise

Grenfell Tower 9497						GREEN HIGHLIGHT - VERY GOOD STANDARD	YELLOW HIGHLIGHT - NOT YET ACTIONED					CALL OUT RISK			POTENTIAL COST OF CALL			DATE RECTIFIED	COMMENTS
No of inspections	Item Number	DATE OF INSPECTION	BLOCK / FLOOR / PLOT	LOCATION	ISSUE DESCRIPTION / STANDARD	PICTURE	JSW / SUB CONTRACTOR	STATUS	SMAGGED Y / N	COMMISSIONED	PAINTED OVER	CLOSED PRACTICE	LOW	MEDIUM	HIGH	LOW	MEDIUM		
7	1	12/08/2015	Walkway plus 1 disabled access flat	Bedroom with ensuite	Radiator has been installed poorly. The pipework is unlevel and the radiator bracket has been damaged		JSW	2nd fix	N	N	N				1		1		
7	2	12/08/2015	Walkway plus 1 disabled access flat	Bedroom 2	White clips on the radiator brackets have not been installed		JSW	2nd fix	N	N	N		1			1			
7	3	12/08/2015	Walkway plus 1 Flat A	Bedroom	Bent radiator bracket		JSW	2nd fix	N	N	N			1		1			
7	4	12/08/2015	Walkway plus 1 Flat D	Kitchen	Hot and cold pipework at high level Geberit press fit no depth marks on the pipework please cut out		JSW	2nd fix	N	N	N				1		1		
7		12/08/2015	Summary										0	1	1	2	1	2	1
		Please can you ensure when installing Geberit press fit that depth gauges are on all pipework.																	
		Please ensure when installing radiators that the radiator is level before installing the pipework.																	