

To: Smith, Harvey[Harvey.Smith@trio.co.uk]; Stevens, Stuart (Borehamwood)[Stuart.Stevens@trio.co.uk]; Talbot, Cerianne[Cerianne.Talbot@trio.co.uk]; MOBS, NL[NL.MOBS@trio.co.uk]; K & S PIPE CONTRACTORS LLP[ken@k-spipecontractors.co.uk]
From: Simon BOYGLE
Sent: Tue 01/11/2016 8:38:50 AM
Subject: Grenfell tower.....imgm 170186

Morning Harvey

As requested I had another look at the landings to avoid running any pipework within the heating pipe boxing.

I've measured up floor to ceiling heights.

- floor to original ceiling; 2335mm.
- floor to plasterboard; 2106mm.
- depth plasterboard box; 229mm.
- depth door frame above front door; 100mm.

Due to a decent depth of approx 100mm for the frame above the front door, It should be possible run a lateral around tight in the corner of each landing to all properties, avoiding running across the plasterboard and over the mechanical air vents.

GAS METER RESITES

All flats have an area of between 1m & 4m that back onto the communal landings which can be drilled through for new gas meter positions.


There are a variety of cupboards to relocate the meter into.

OUTLETS

Outlet works would require a rerun back to the original meter positions which is closest to the resite. Allow 10m outlet per flat.

VENTILATION/G5


Once the pipe work is installed, the riser system could be segregated from the mechanical air extraction by being boxed in. There is a route out to fresh air through the basement & would assume a route out through the top floor (no access to roof as locked).

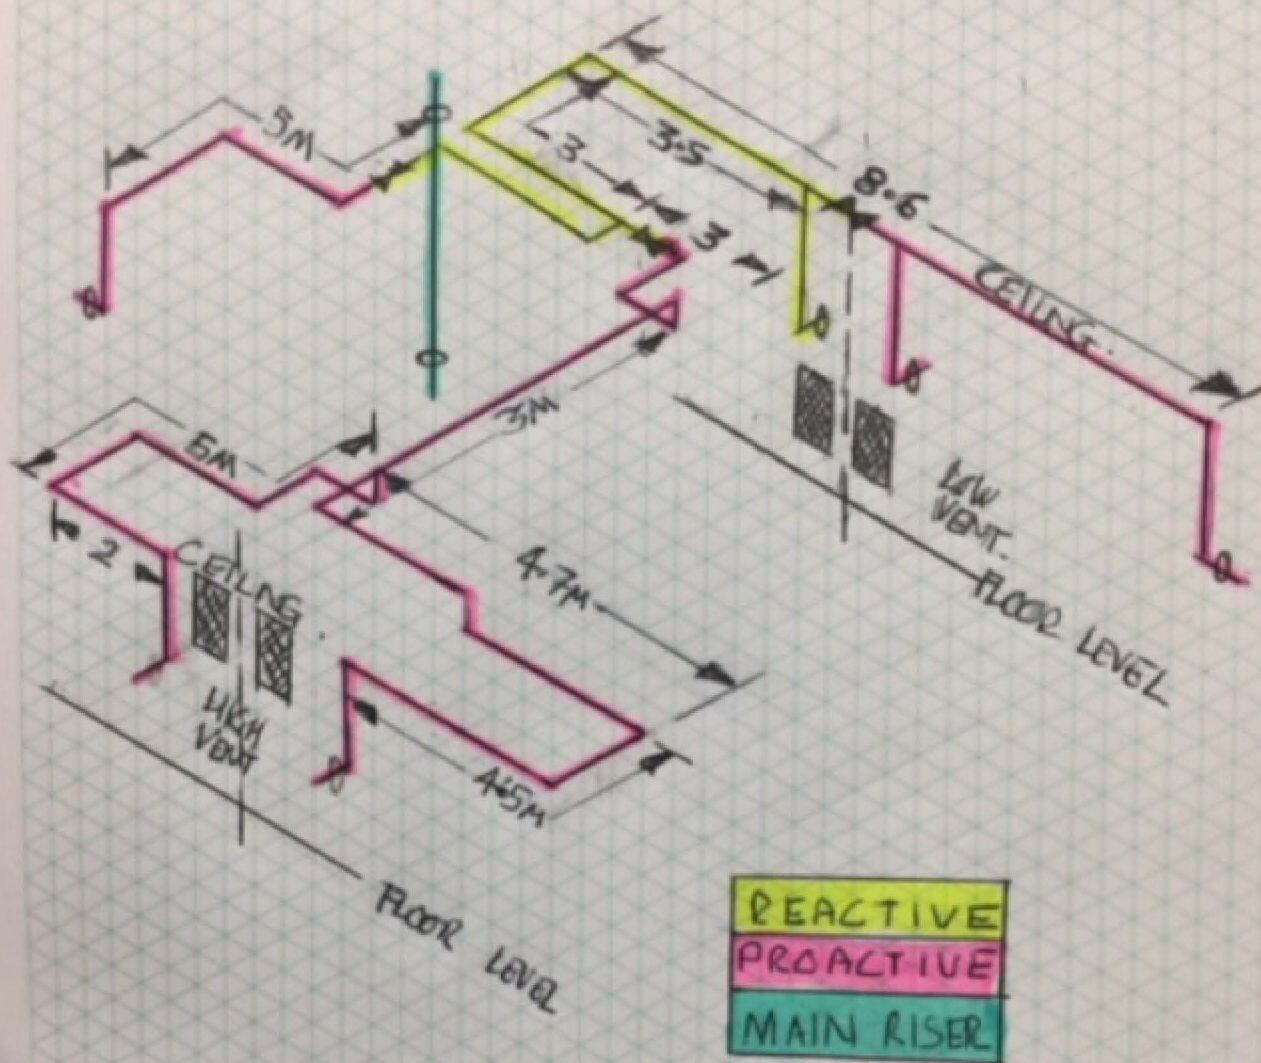

Grenfell
Tower
IMGM 170186

Floor plan

Grenfell Tower
IMG M 170186

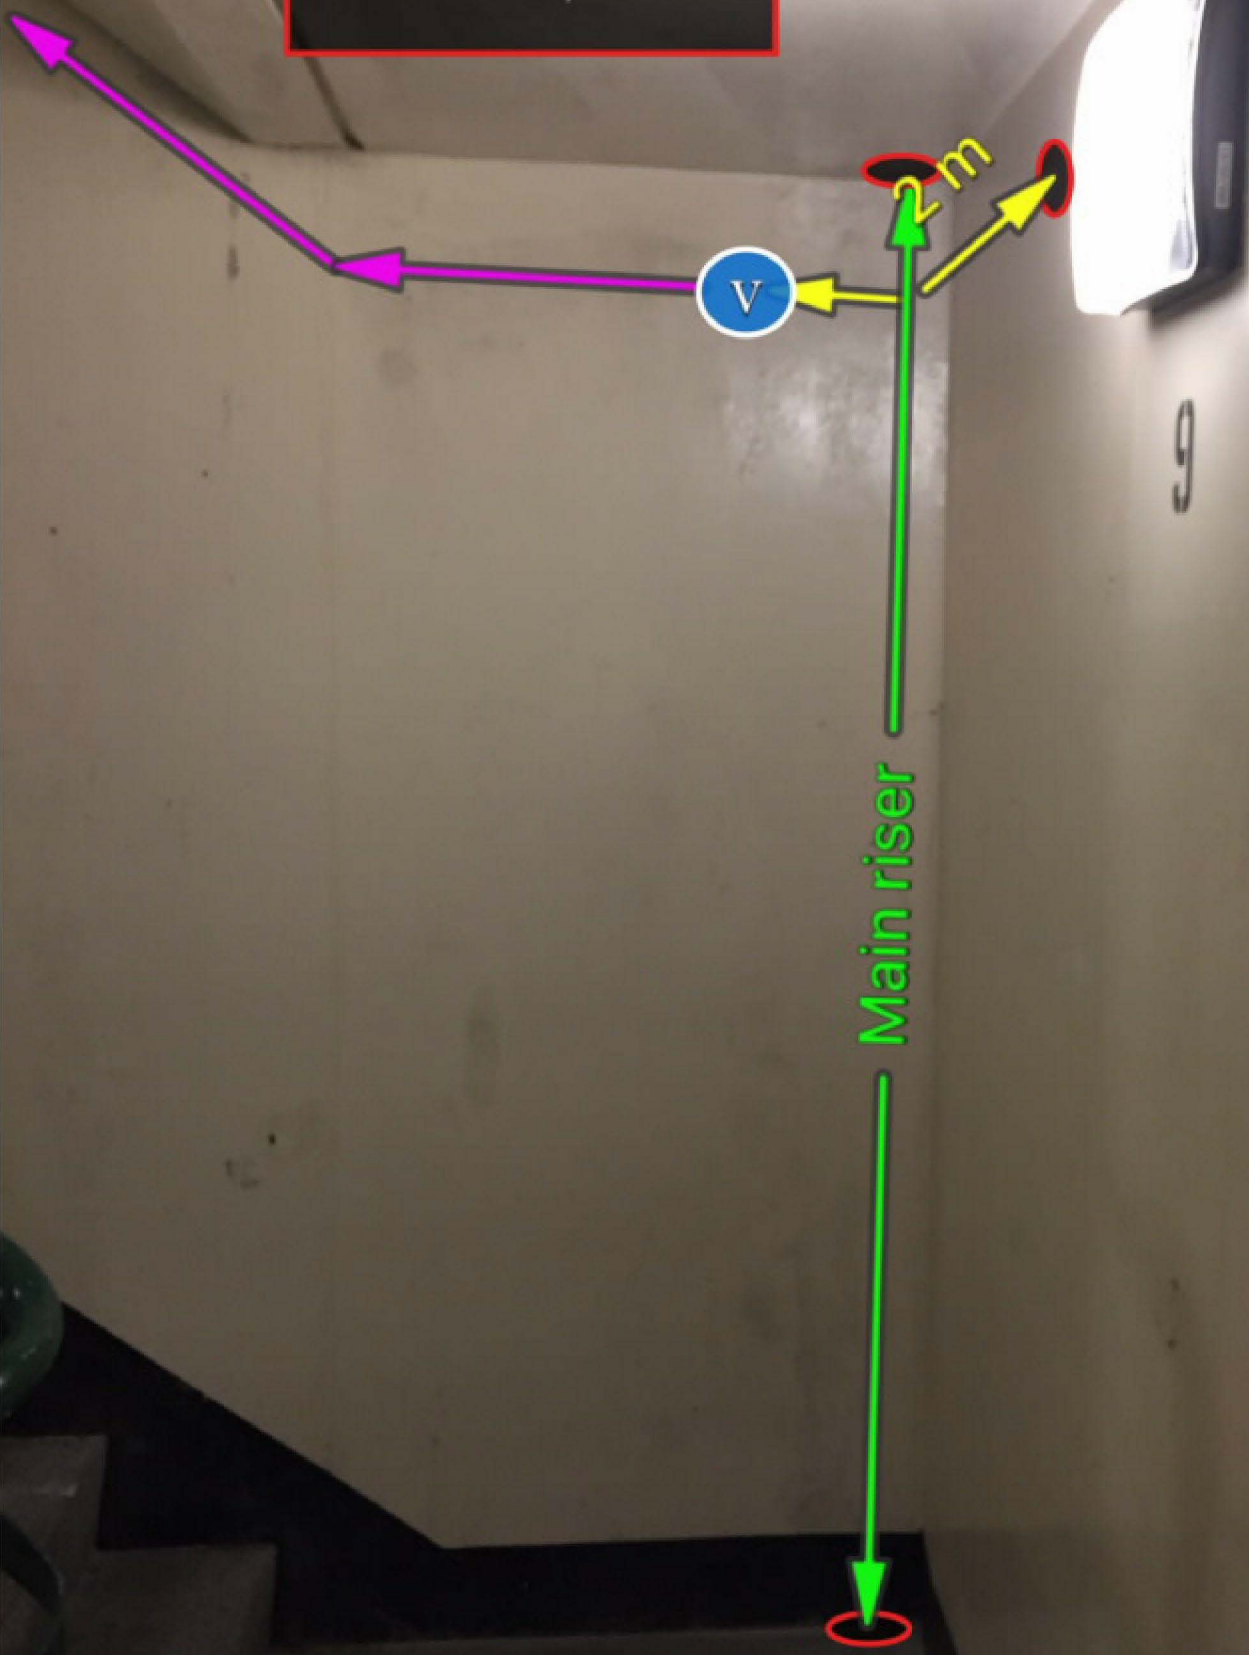

Grenfell Tower
IMG 170186

proactive

Grenfell Tower
IMG 170186

Reactive
Proactive

Grenfell
Tower
IMG170186

Grenfell
Tower
IMG170186

proactive

V

Grenfell Tower
IMG 170186

proactive

Grenfell Tower
IMG 170186

proactive

Grenfell Tower
IMG 170186

proactive

Kind regards

Simon Boygle
sent from my iPhone

SMELL GAS? CALL.....[0800111999](tel:0800111999)

London Operations....Gas
SURVEYING DEPARTMENT
MULTI-OCCUPANCY BUILDINGS

For and on behalf of;
tRIIO®

Customer Services,
tRIIO®
[Albert Road](#)
[Barnet](#)
[EN4 9SH](#)

Office hours only;
office : [+44\(0\)2087321812](tel:+44(0)2087321812)

"Safety starts with me"
This e-mail, and any attachments are strictly confidential and intended for the addressee(s) only. The content may also contain legal, professional or other privileged information. If you are not the intended recipient, please notify the sender immediately and then delete the e-mail and any attachments. You should not disclose, copy or take any action in reliance on this transmission.

You may report the matter by contacting us via our [UK Contacts Page](#) or our [US Contacts Page](#)(accessed by clicking on the appropriate link)

Please ensure you have adequate virus protection before you open or detach any documents from this transmission. National Grid plc and its affiliates do not accept any liability for viruses. An e-mail reply to this address may be subject to monitoring for operational reasons or lawful business practices.

For the registered information on the UK operating companies within the National Grid group please use the attached link: <http://www.nationalgrid.com/corporate/legal/registeredoffices.htm>

We work safely or not at all

tRIIO® is a joint venture partnership between Morrison Utility Services and Skanska Construction UK.
A gas distribution strategic partner.

The information contained in this message is likely to be confidential and may be legally privileged. It is intended solely for the use of the individual or entity to which it is addressed. If you have received this message by mistake, please let us know immediately by replying to this email and then delete all copies of the email from your system. If you are not the intended recipient you must not disclose, distribute, copy, print or rely on this email. Whilst we have taken reasonable precautions to ensure that this email and any attachments have been checked for viruses we cannot guarantee that they are virus free and we cannot accept liability for any damage sustained as a result of software viruses. We would advise that you carry out your own virus checks especially before opening an attachment.

tRIIO® cannot accept any responsibility for the accuracy or completeness of this email and unless otherwise expressly stated does not authorise any contract to be made by email. tRIIO® may recall, delete and monitor all outgoing and

incoming emails.

Morrison Utility Services Limited

Registered Office: Morrison House, Primett Road, Stevenage, Hertfordshire SG1 3EE

Registered in England. Company Number [4530602](#)

Skanska Construction UK Limited

Registered Office: Maple Cross House, Denham Way, Maple Cross, Rickmansworth, Hertfordshire WD3 9SW

Registered in England. Company Number 191408